



## Hyundai/Kia Power Steering Pump Whine Noise

Ref Hyundai TSB 08-ST-001 Dated August 2008


Kia KT2008092301 Dated 9-23-2008

Applications: ALL Hyundai & Kia Models with remote reservoirs

**Symptom:** Power Steering Pump Whine Noise

**Corrective Action:** When replacing a PS pump or inspecting a complaint for noise or whine from the power steering pump, inspect the PS Reservoir filter screen for contamination. If the screen has debris this will restrict flow and cause starvation to the pump. This may be seen by aeration of the fluid within the reservoir. If debris is found, the reservoir should be replaced.

**Tech Tip:** When testing for flow make sure the PS system is full. If not, fill with the OE Recommended Fluid Type. When inspecting the filter screen at the bottom of the PS reservoir, it may be necessary to empty the reservoir.

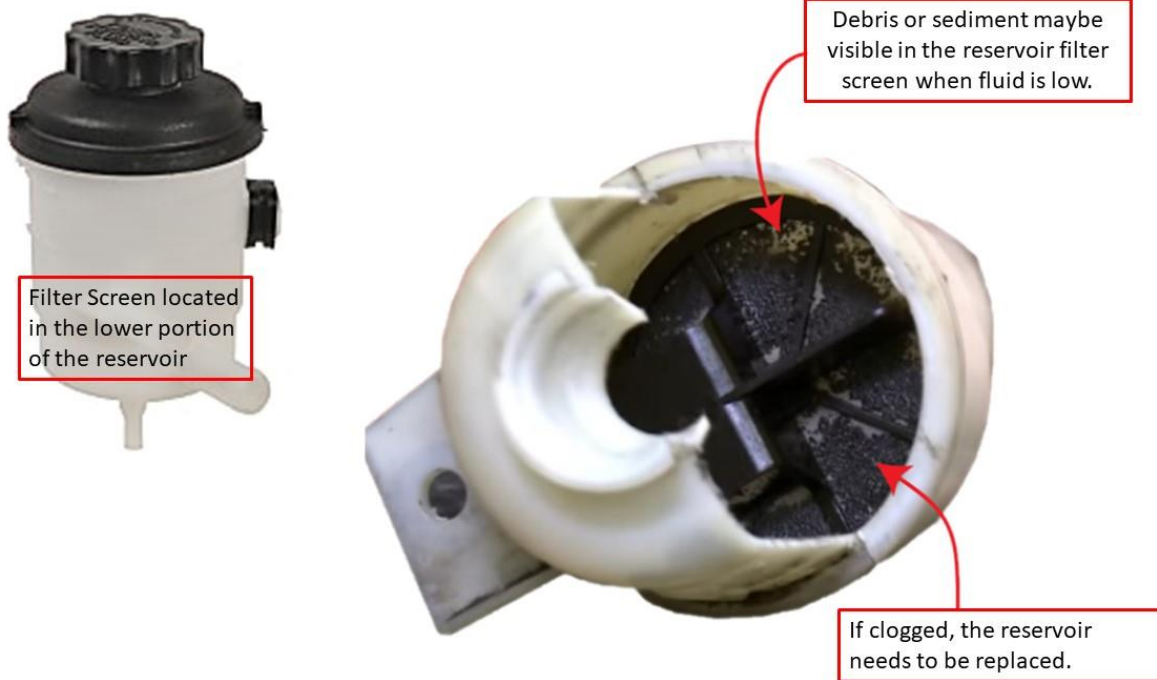

PWR Now offers many applications now in our PXR program that not only includes an *Installation Ready Pump* but a *New and Remote Reservoir* in the box. To check PXR applications, please visit [www.pwrsteer.com](http://www.pwrsteer.com)

